

TBC-BS Series Closed Loop Mode Hall Effect Current Sensor





TBC- BS series current sensor is a closed loop device based on the measuring principle of the hall effect and null balance method, with a galvanic isolation between primary and secondary circuit. It provides accurate electronic measurement of DC, AC or pulsed currents.

Electrical data (Ta=25°C±5°C)

Type Parameter	TBC50BS	TBC100BS	TBC200BS	TBC300BS	Unit
Rated input (Ipn)	±50	±100	±200	±300	А
Measure range (lp)	±150 (±18V,90Ω)	±300 (±18V,30Ω)	±600 (±18V,20Ω)	±900 (±18V,5Ω)	А
Turns ratio (Np/Ns)	1:1000	1:1000	1:2000	1:3000	Т
Rated output (Isn)	50±0.5%	100±0.5%	100±0.5%	100±0.5%	mA
Coil resister @70°C	20	20	30	50	Ω
Measure resister	2 ~ 50				Ω
Supply voltage	±12 ~ ±18				V
Power consumption	≤20+IpX (Np/Ns)				mA
Zero offset	@Ip=0 \le \pm 0.15				mA
Zero drift	≤±0.4				mA
Linearity	@lp=0-±lpn ≤0.1			%FS	
Band- width	@-3dB DC-200			KHz	
Response time	@100A/μS,10%-90% ≤1			μS	
Galvanic isolation	@ 50HZ, AC,1min 3			KV	




TBC-BS Series Closed Loop Mode Hall Effect

Current Sensor

Applications

- AC variable speed drives
- Static converters for DC motor drives
- Variable speed drives
- Power supplies for welding applications
- Battery supplied applications
- Uninterruptible Power Supplies (UPS)
- Switched Mode Power Supplies (SMPS)

Mechanical dimension (for reference only)

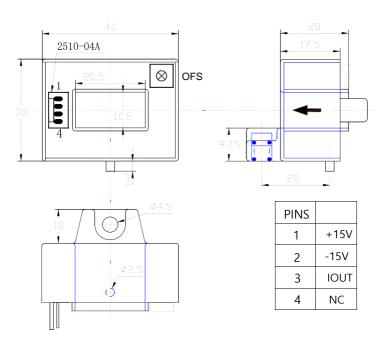

Remarks:

- 1. All dimensions are in mm.
- 2. General tolerance ±1mm.

Directions for use

- 1. When measure current flows according to the direction of the arrowhead, Output terminal gets the same phase current.
- 2. When the current will be measured goes through a sensor, the current will be measured at the output end. (Note: The false wiring may result in the damage of the sensor)

2



TBC-BS Series Closed Loop Mode Hall Effect

Current Sensor

3. Custom design in the different rated input current and the output current are available.

Standards

UL94-V0.

EN60947-1:2004

IEC60950-1:2001

EN50178:1998


SJ 20790-2000

General data

	Value	Unit	Symbol
Operating temperature	-40 to +85	°C	TA
Storage temperature	-40 to +125	°C	TS
Mass(approx)	40	a	М

Characteristics chart

Pulse current signal response characteristic

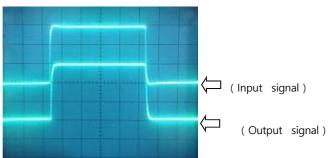

Effects of impulse noise

